

Blue

Work Order ID 53414

November 4, 2009 7:38:58 AM



Page 1

Item ID: D206-667-203TRN

Accept



Setup Start



Revision ID: C

Stop



Item Name: Crosstube Turning Detail

Start Date: 11/04/09 Start Qty: 1.00



Cust Item ID:

Required Date: 11/06/09 Req'd Qty: 1.00

Customer:

Reference:

Approvals:

Process Plan:

[Signature]

Date: 09-11-11

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D206-667-243	Rev C

100	MORI SEIKI CNC LATHE LARGE	0.00							
	Mori Seiki	Memo	0.00						
Mori Seiki CNC Lathe Large	1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA089□2-Turn first side as per Folio FA089□3-File down transition lines smooth.								

a.m. 09-11-11 -160

110	QC1- Inspect dimensions to dimension sheet	0.00							
	QC	Memo	0.00						
Quality Control									

a.m. 09-11-11 -160

120	MORI SEIKI CNC LATHE LARGE	0.00							
	Mori Seiki	Memo	0.00						
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA089□2-File down transition lines smooth. □ 3-Remove sand and plugs□4-Scrib part# and batch #.								

a.m. 09-11-11 -160

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 53414

November 4, 2009 7:38:58 AM

Page 2

Item ID: D206-667-203TRN

Accept

Setup Start

Revision ID: C

Stop

Item Name: Crosstube Turning Detail

Start Date: 11/04/09 Start Qty: 1.00

Cust Item ID:

Required Date: 11/06/09 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Qm 09 11 - 16 D

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00


Quality Control

1 - AWM 9-11-19

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1 - AWM 9-11-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 53414

November 4, 2009 7:38:59 AM



Page 3

Item ID: D206-667-203TRN

Accept



Setup Start



Revision ID: C

Stop



Item Name: Crosstube Turning Detail

Start Date: 11/04/09 Start Qty: 1.00



Cust Item ID:

Required Date: 11/06/09 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

160



QC

Quality Control

QC3- Inspect Part Finish

0.00

Memo

0.00

1 11/9/11/19

170



Packaging

Packaging

Packaging

0.00

Memo

Identify and Stock in kanban rack

0.00

X-TUBE CELL

1 - - 11/9/11-19

180



QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

Memo

0.00

09/11/19

RL 09-11-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

November 4, 2009 7:38:57 AM

Page 1

Work Order ID: 53414



Parent Item: D206-667-203TRNRevC



Parent Item Name: Crosstube Turning Detail

Start Date: 11/04/09

Required Date: 11/06/09

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D6004-115RevA		Manufactured	No			100	Each	70.0000	1.0000			



Crosstube Material



A.M. 09-11-16 @

Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

LG

70

34685

17

34774

23

38336

30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 53414
Description: Crosstube Assembly	Part Number: D206-667-243
Inspection Dwg: D206-667-243 Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.490	/			
	2.018	+0.005/-0.000	2.023	/			
	2.079	+0.005/-0.000	2.084	/			
	2.145	+0.005/-0.000	2.150	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.291	/			
	2.363	+0.005/-0.000	2.365	/			
	2.433	+0.005/-0.000	2.438	/			
	0.200	+/-0.010	0.200	/			
	0.500 x 30°	+/-0.010	0.500 x 30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			
SIDE B	104.91	+/-0.020	104.90	/			
	2.490	+0.005/-0.000	2.490	/			
	2.018	+0.005/-0.000	2.023	/			
	2.079	+0.005/-0.000	2.084	/			
	2.145	+0.005/-0.000	2.150	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.291	/			
	2.363	+0.005/-0.000	2.365	/			
	2.433	+0.005/-0.000	2.438	/			
	0.200	+/-0.010	0.200	/			
	0.500 x 30°	+/-0.010	0.500 x 30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			

Measured by: G.M	Audited by: AWM	Prototype Approval:	N/A
Date: 9-11-16	Date: 9-11-19	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.09.01	New Issue (P/O D206-667-203)	KJ/JLM	

Item	Qty -243	Part Number	Description
1	X	D206-667-243	CROSSTUBE ASSEMBLY (206L HIGH AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 104.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-243" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 21.9 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHORTLY
RETURNED
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENTS
WITHOUT NOTICE
WORK ORDER
NO. 53414
B10911-4



RELEASED
6/11/74

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-450 WAS D2858-400-773 (ZN D8-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN 4-3, C5-3, D3-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. C
CHECKED	RF	D206-667-243	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DE APPR.	RF	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 53414


RELEASED

- 12 D2892-1 SUPPORT
2 PL
- 15 MS21920-22 CLAMP
4 PL
- 13 D3595-063-450
RUBBER CUSHION
4 PL (UNDER CLAMP)

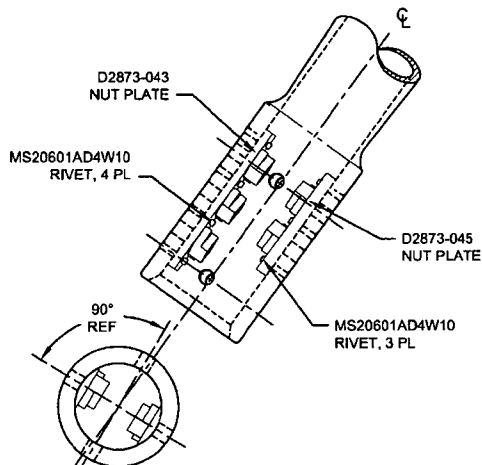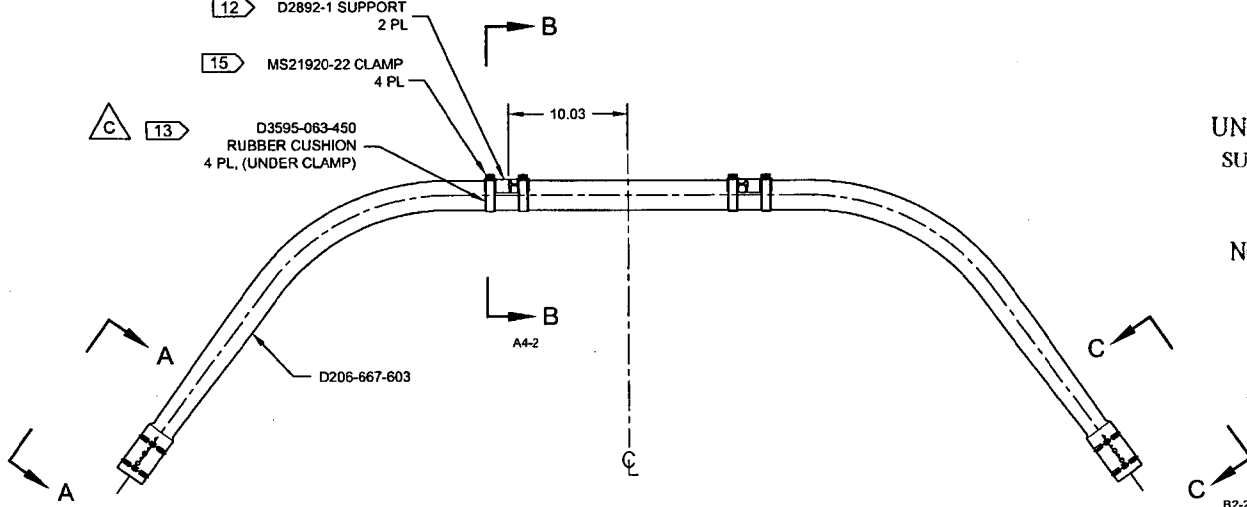


VIEW A-A:
CUFF DETAIL
SCALE 4X

D206-667-243
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

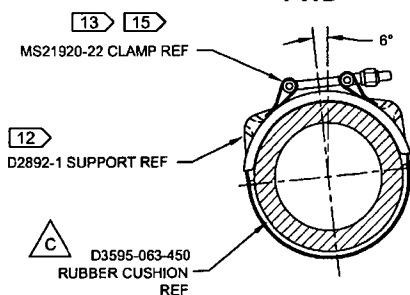


SECTION B-B
SCALE 5X

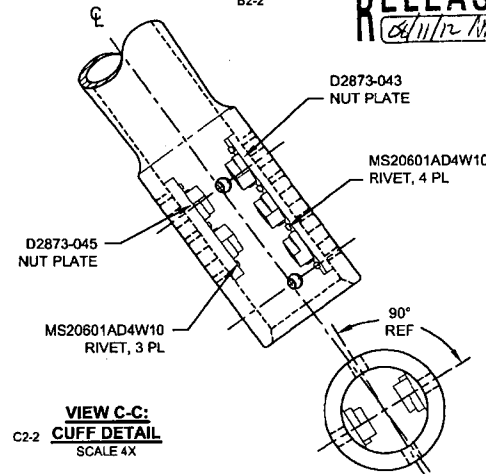

VIEW C-C:
CUFF DETAIL
SCALE 4X

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. C
MFG. APPR.	9	D206-667-243	SHEET 2 OF 4
APPROVED	9	TITLE	SCALE
DE APPR.	9	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY

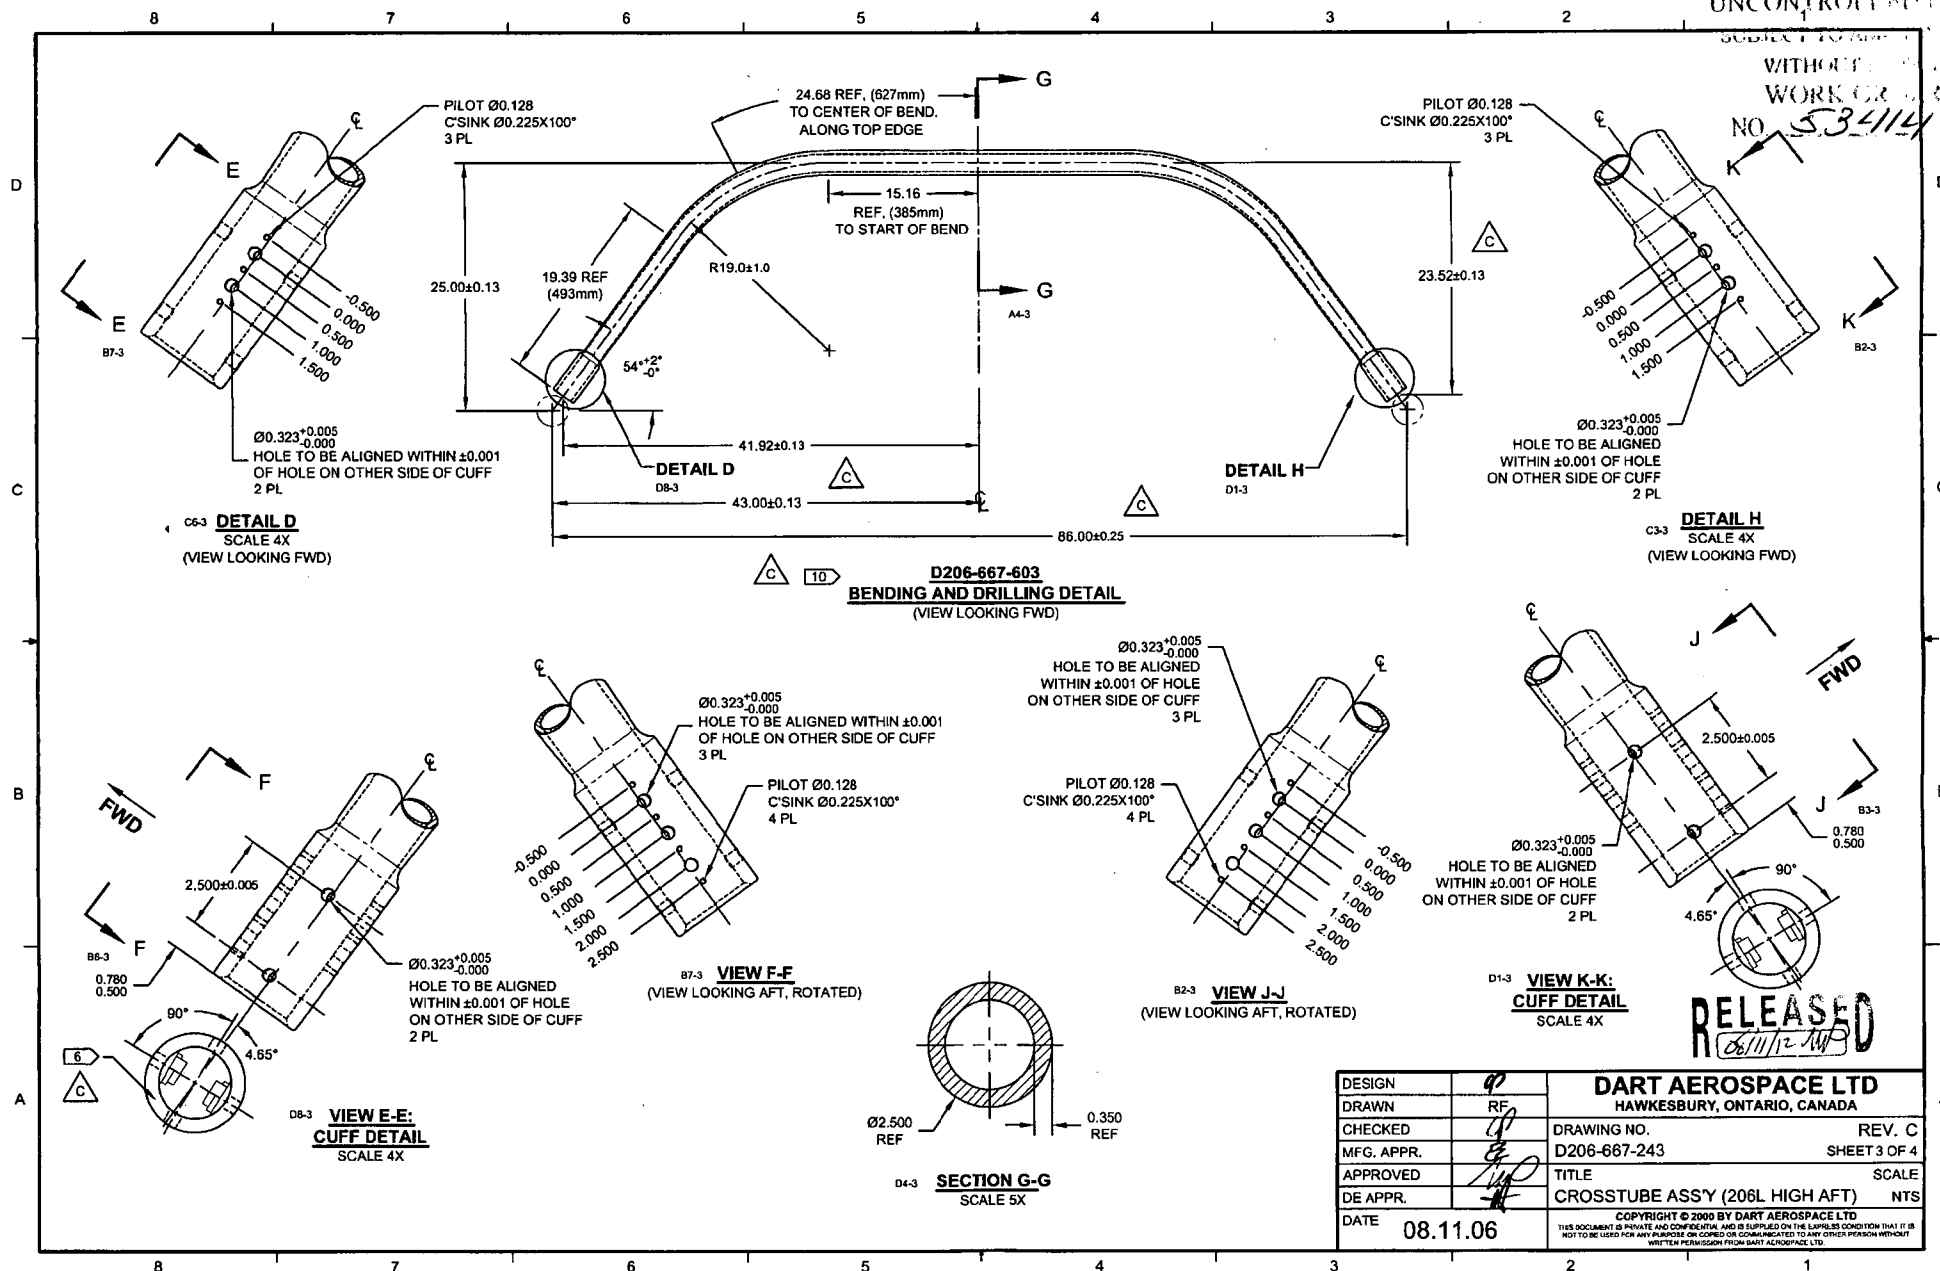


RELEASED
08/11/12

SHOP COPY
RETURN TO


UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 53414

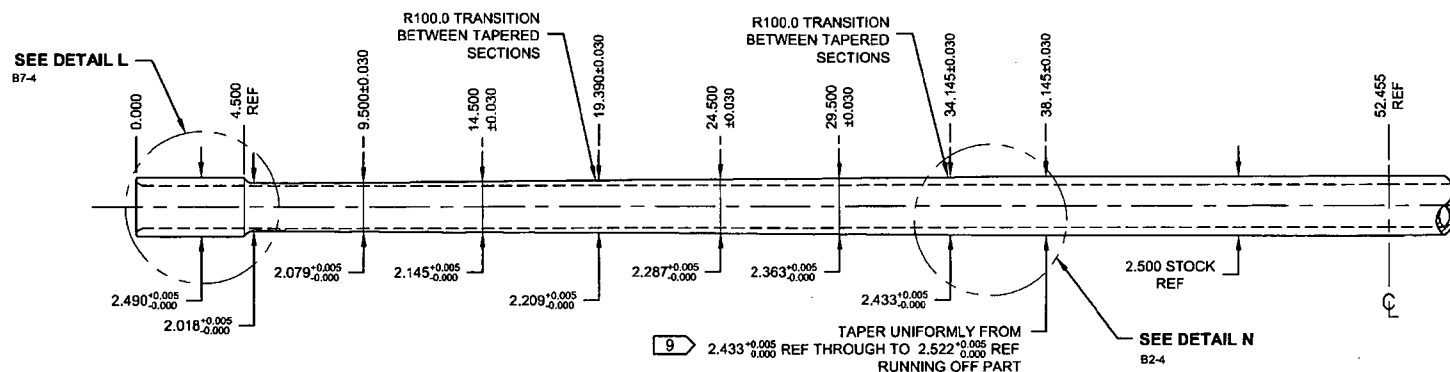


C TURNING DETAIL

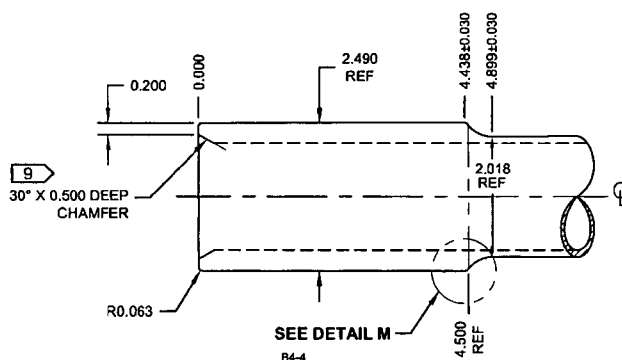

DETAIL L: CROSSTUBE CUFF
NOT TO SCALE

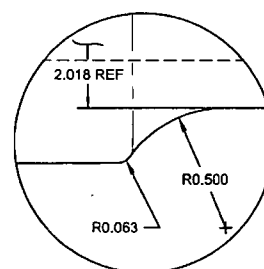

DETAIL M: CUFF TRANSITION
NOT TO SCALE

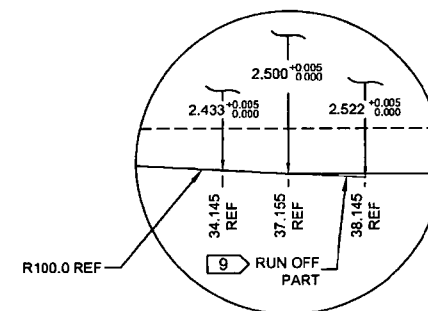

DETAIL N: TAPER RUN-OFF
NOT TO SCALE

RELEASED
08/11/06

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. C
MFG. APPR.	40	D206-667-243	SHEET 4 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			